## DATA SHEET

Three Phase Induction Motor - Squirrel Cage


:



## Customer

	Phas	e				
Frame		: 80L/MS		Locked rotor time	: 9s (cold) 5	5s (hot)
Output		: 7.5 HP (	5.5 kW)	Temperature rise	: 80 K	. ,
Poles		:2	,	Duty cycle	: S1	
Frequency		: 60 Hz		Ambient temperature	: -20°C to +	40°C
Rated voltage		: 575 V		Altitude	: 1000 m.a.	
Rated current		: 7.81 A		Protection degree	: IP54	•
L. R. Amperes		: 71.8 A		Cooling method	: IC411 - TE	FC
LRC		: 9.2		Mounting	: B3R(D)	
No load current		: 3.52 A		Rotation <sup>1</sup>	: CCW	
Rated speed		: 3490 rpn	n	Noise level <sup>2</sup>	: 62.0 dB(A	)
Slip		: 3.06 %	1	Starting method	: Direct On	
Rated torque		: 1.56 kgfr	n	Approx. weight <sup>3</sup>	: 55.5 kg	LINC
Locked rotor torque		: 400 %		Approx. weight	. 00.0 kg	
Breakdown torqu		: 459 %				
Insulation class	ue	. 439 % : F				
Service factor		. F : 1.00				
			aua 2			
Moment of inerti	a (J)	: 0.0061 k	gm-			
Design		: N				
Output	50%	75%	100%	Foundation loads		
Efficiency (%)	85.2	87.0	87.4	Max. traction	: 123 kgf	
Power Factor	0.64	0.75	0.81	Max. compression	: 178 kgf	
			Drive end	Non drive e	end	
Bearing type		:	6307 ZZ	6207 ZZ		
Sealing		: Wit	hout Bearing Seal	Without Beari	ng Seal	
Lubrication inter	val	:	-	-	0	
Lubricant amour						
			-	-		
Lubricant type		:	- Mol	- bil Polyrex EM		
		:	Mo	- bil Polyrex EM		
Notes: This revision repl		ancel the previ		These are average valu		
Notes: This revision repl must be eliminate (1) Looking the m (2) Measured at (3) Approximate manufacturing pr (4) At 100% of fu	ed. notor from th 1m and with weight subje rocess.	e shaft end. tolerance of - ect to changes	ious one, which ⊧3dB(A). ∋ after	These are average valu power supply, subject to MG-1.	o the tolerances stipu	lated in NEMA
Notes: This revision repl must be eliminate (1) Looking the m (2) Measured at (3) Approximate manufacturing pr	ed. notor from th 1m and with weight subje rocess.	e shaft end. tolerance of - ect to changes	ious one, which ⊧3dB(A).	These are average valu power supply, subject to		
Notes: This revision repl must be eliminate (1) Looking the m (2) Measured at (3) Approximate manufacturing pr (4) At 100% of fu Rev.	ed. notor from th 1m and with weight subje rocess.	e shaft end. tolerance of - ect to changes	ious one, which ⊧3dB(A). ∋ after	These are average valu power supply, subject to MG-1.	o the tolerances stipu	lated in NEMA
Notes: This revision repl must be eliminate (1) Looking the m (2) Measured at (3) Approximate manufacturing pr (4) At 100% of fu	ed. notor from th 1m and with weight subje rocess.	e shaft end. tolerance of - ect to changes	ious one, which ⊧3dB(A). ∋ after	These are average valu power supply, subject to MG-1.	o the tolerances stipu	lated in NEMA
Notes: This revision repl must be eliminate (1) Looking the m (2) Measured at (3) Approximate m manufacturing pr (4) At 100% of fu Rev. Performed by	ed. notor from th 1m and with weight subje rocess.	e shaft end. tolerance of - ect to changes	ious one, which ⊧3dB(A). ∋ after	These are average valu power supply, subject to MG-1.	o the tolerances stipu Checked	lated in NEMA
Notes: This revision repl must be eliminate (1) Looking the m (2) Measured at (3) Approximate manufacturing pr (4) At 100% of fu Rev.	ed. notor from th 1m and with weight subje rocess.	e shaft end. tolerance of - ect to changes Change	ious one, which ⊧3dB(A). ∋ after	These are average valu power supply, subject to MG-1.	o the tolerances stipu	lated in NEMA

This document is exclusive property of WEG S/A. Reprinting is not allowed without written authorization of WEG S/A. Subject to change without notice

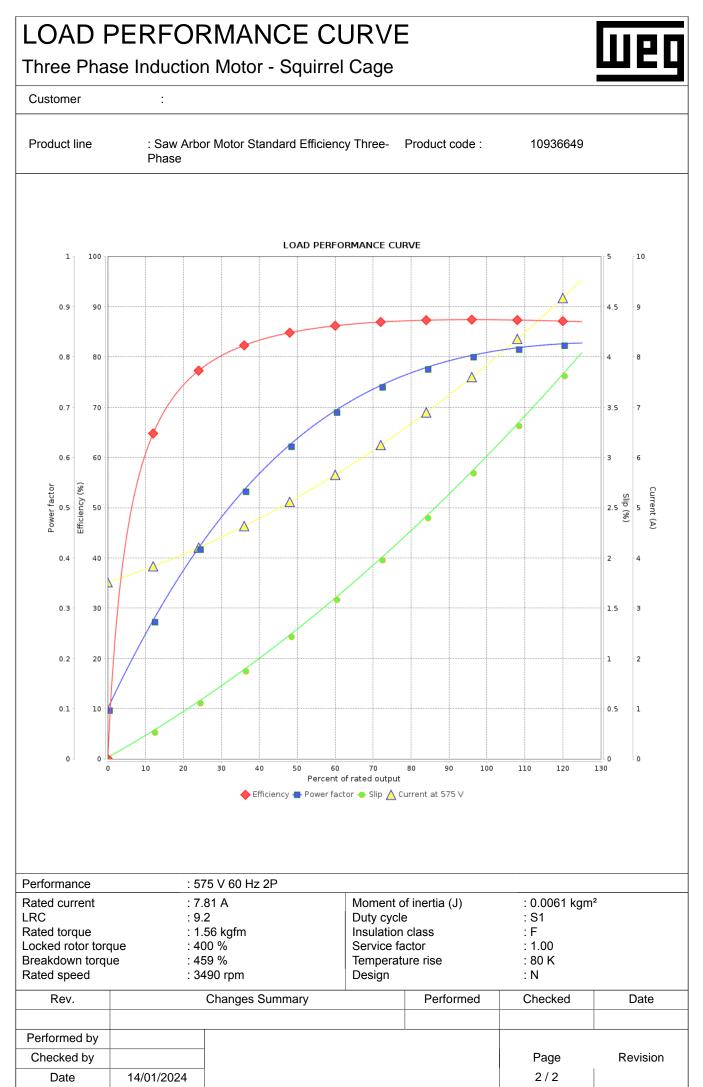

This document is exclusive property of WEG S/A. Reprinting is not allowed without written authorization of WEG S/A.

Subject to change without notice