DATA SHEET

Three Phase Induction Motor - Squirrel Cage

:


Customer

		: Standard Efficiency Three-		13286642
Frame Insulation class Duty cycle		: 56 : F : Cont.(S1)	Cooling method Mounting Rotation ¹	: IC01 - ODP : F-1 : Both (CW and CCW)
Ambient temperature		: -20°C to +40°C	Starting method	: Direct On Line
Altitude		: 1000 m.a.s.l.	Approx. weight ³	: 10.1 kg
Design		: A	Moment of inertia (J)	: 0.0030 kgm²
Output [HP]		1	1	1
Poles		4	4	4
Frequency [Hz]		60	50	50
Rated voltage [V]		230/460	190/380	220/415
Rated current [A]		3.60/1.80	3.84/1.92	3.90/2.07
L. R. Amperes [A]		23.8/11.9	19.6/9.79	20.7/11.0
LRC [A]		6.6x(Code L)	5.1x(Code H)	5.3x(Code J)
No load current [A]		2.80/1.40	2.80/1.40	3.77/2.00
Rated speed [RPM]		1750	1425	1440
Slip [%]		2.78	5.00	4.00
Rated torque [kgfm]		0.415	0.509	0.504
Locked rotor torque [%]		250	160	200
Breakdown torque [%]		290	210	250
Service factor			1.00	1.00
Temperature rise		80 K	105 K	105 K
Locked rotor time		18s (cold) 10s (hot)	Os (cold) Os (hot)	Os (cold) Os (hot)
Noise level ²		52.0 dB(A)	49.0 dB(A)	49.0 dB(A)
	25%			
Efficiency (%)	50%	68.0	70.6	61.8
	75%	74.0	74.4	69.2
	100%	77.0	74.2	72.0
	25%			12.0
Power Factor	50%	0.44	0.56	0.46
	75%	0.58	0.70	0.40
	100%	0.68	0.70	0.39
	10070	Drive end Non drive en		0.10
Bearing type Sealing		: 6204 ZZ 6202 ZZ		
		: Without Without	Max. traction	: 35 kgf
			Max. compression	: 45 kgf
Lubrication interval		Bearing Seal Bearing Sea	21	
Lubricant amount		· · ·		
Lubricant type		: Mobil Polyrex EM		
Notes		<u>·</u>		
USABLE @208V	3.98A SF 1.	JU SFA 3.98A		
must be eliminate (1) Looking the m (2) Measured at	ed. notor from the 1m and with t weight subjec ocess.	ncel the previous one, which e shaft end. olerance of +3dB(A). et to changes after		based on tests with sinusoidal ne tolerances stipulated in NEM/
must be eliminate (1) Looking the m (2) Measured at (3) Approximate manufacturing pr	ed. notor from the 1m and with t weight subjec ocess.	shaft end. olerance of +3dB(A).	power supply, subject to th	
must be eliminate (1) Looking the m (2) Measured at (3) Approximate manufacturing pr (4) At 100% of fu	ed. notor from the 1m and with t weight subjec ocess.	e shaft end. olerance of +3dB(A). et to changes after	power supply, subject to th MG-1.	ne tolerances stipulated in NEM
must be eliminate (1) Looking the m (2) Measured at (3) Approximate manufacturing pr (4) At 100% of fu	ed. notor from the 1m and with t weight subjec ocess.	e shaft end. olerance of +3dB(A). et to changes after	power supply, subject to th MG-1.	ne tolerances stipulated in NEM
must be eliminate (1) Looking the m (2) Measured at (3) Approximate manufacturing pr (4) At 100% of fu Rev. Performed by	ed. notor from the 1m and with t weight subjec ocess.	e shaft end. olerance of +3dB(A). et to changes after	power supply, subject to th MG-1.	ne tolerances stipulated in NEMA
must be eliminate (1) Looking the m (2) Measured at (3) Approximate manufacturing pr (4) At 100% of fu Rev.	ed. notor from the 1m and with t weight subjec ocess.	e shaft end. olerance of +3dB(A). tt to changes after Changes Summary	power supply, subject to th MG-1.	ne tolerances stipulated in NEM

Weq

 e
 17/05/2022
 1 / 4

 This document is exclusive property of WEG S/A. Reprinting is not allowed without written authorization of WEG S/A.

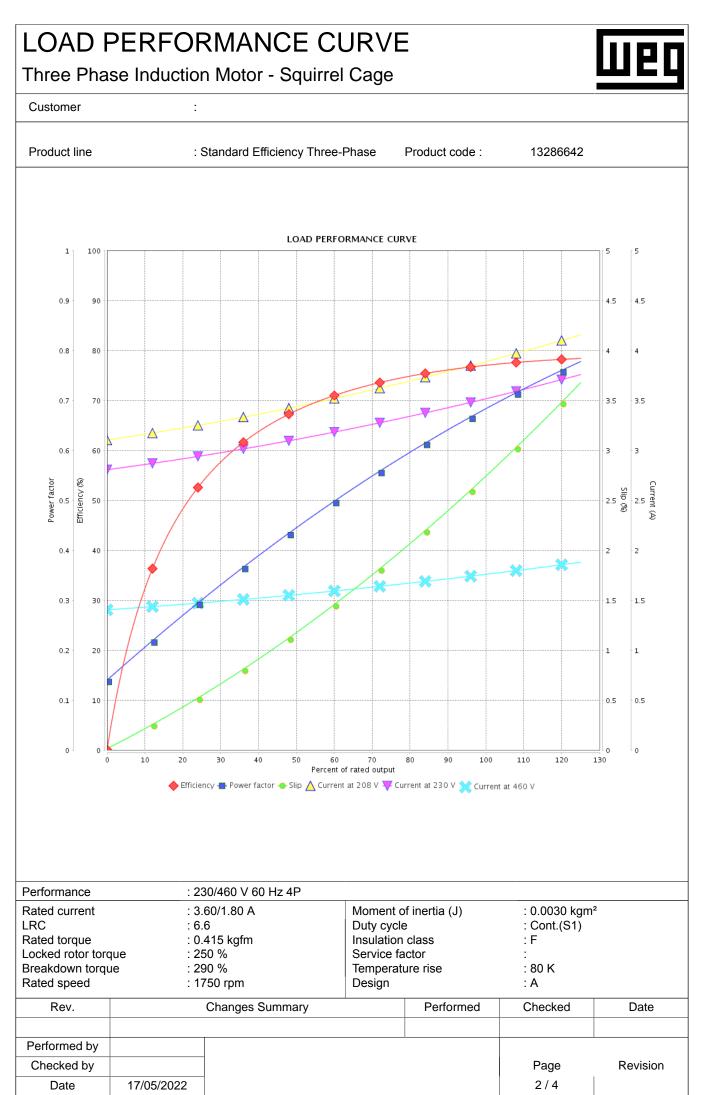


This document is exclusive property of WEG S/A. Reprinting is not allowed without written authorization of WEG S/A.

LOAD PERFORMANCE CURVE


Three Phase Induction Motor - Squirrel Cage

:

Customer

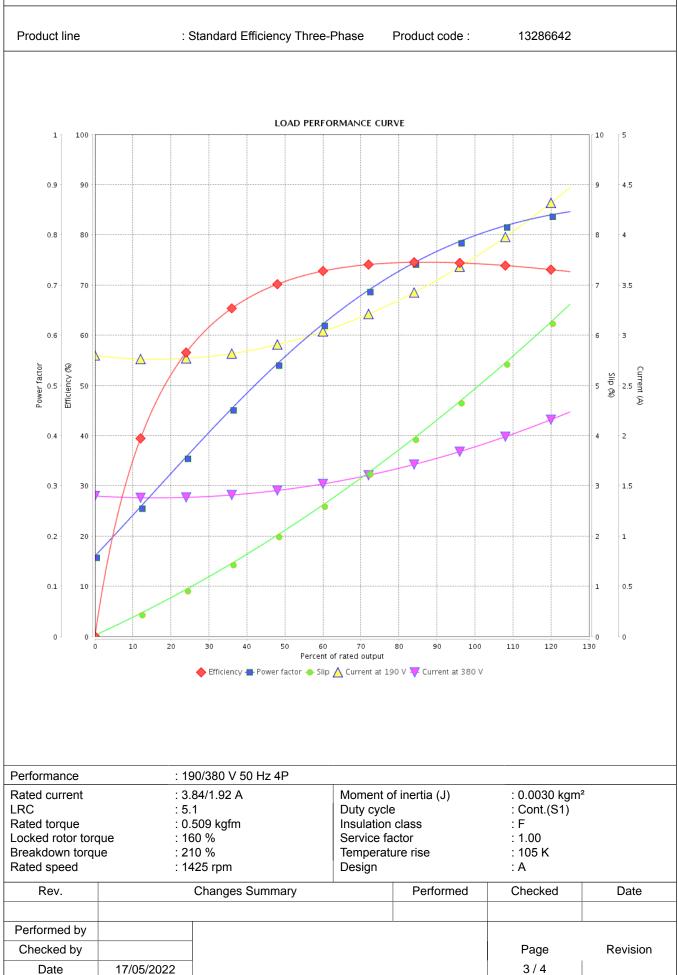

This document is exclusive property of WEG S/A. Reprinting is not allowed without written authorization of WEG S/A.

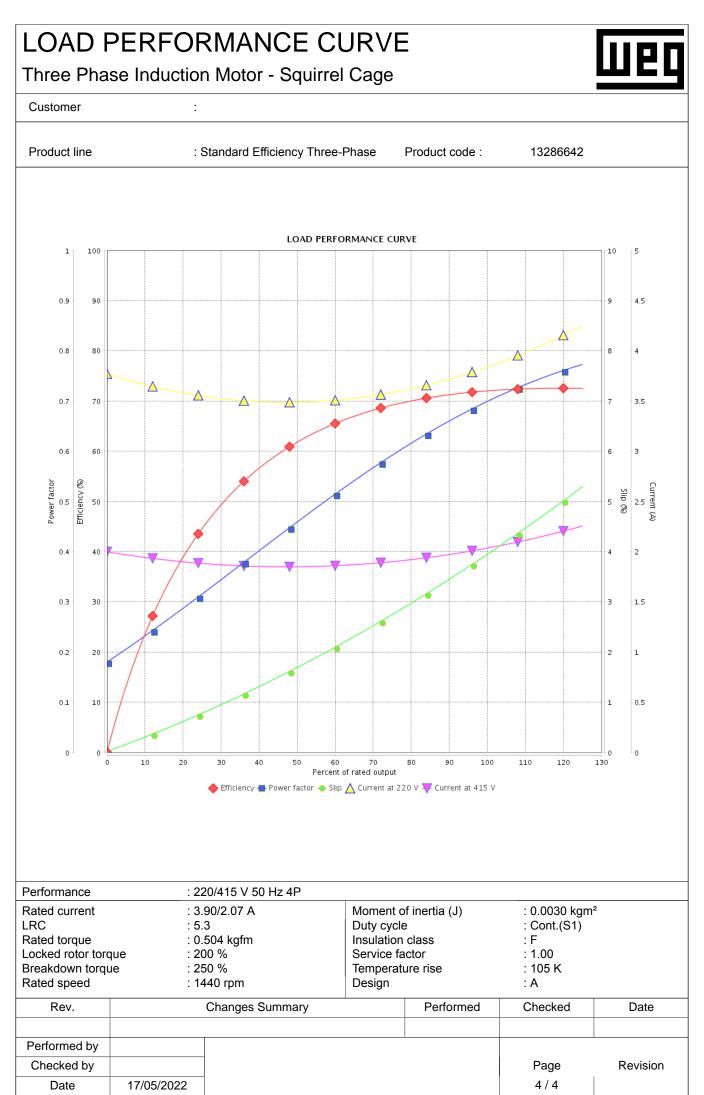

This document is exclusive property of WEG S/A. Reprinting is not allowed without written authorization of WEG S/A.